



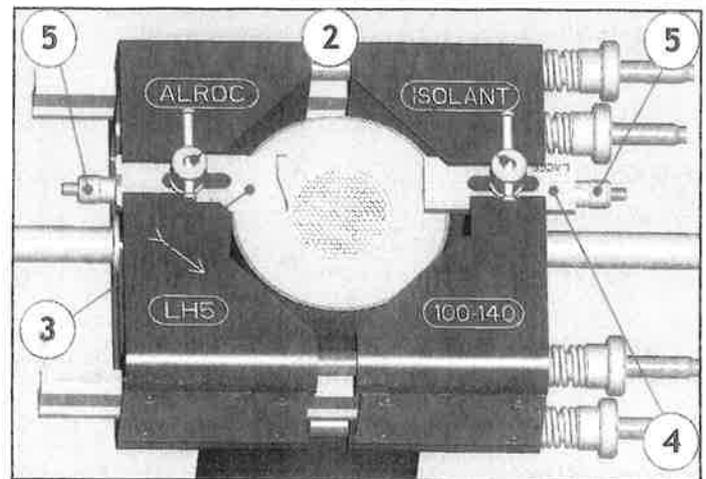

LH2 - LH3 - LH4 - LH5 Instructions for use



1- Ruling of the tool

- Fit the LH tool onto the cable.
- Tighten knurled nuts. (1).
- Unscrew the two VBL (2).
- Preset the blade (3) and the back-iron (4) with the feed buttons (5).
- Tighten VBL (2).

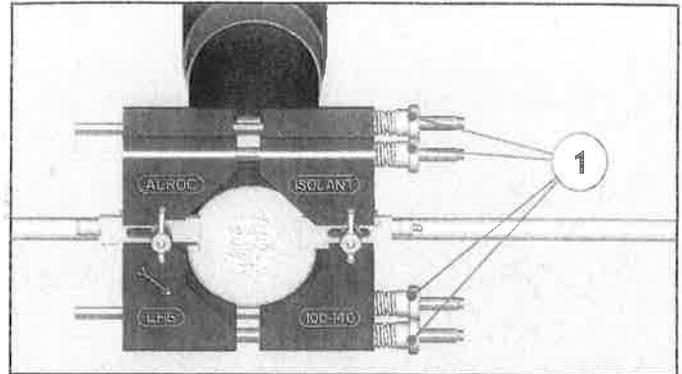

2- Insulation removal

- Rotate the LH tool in the direction of the arrow until the wanted length
- Unscrew the knurled nuts and remove the tool.

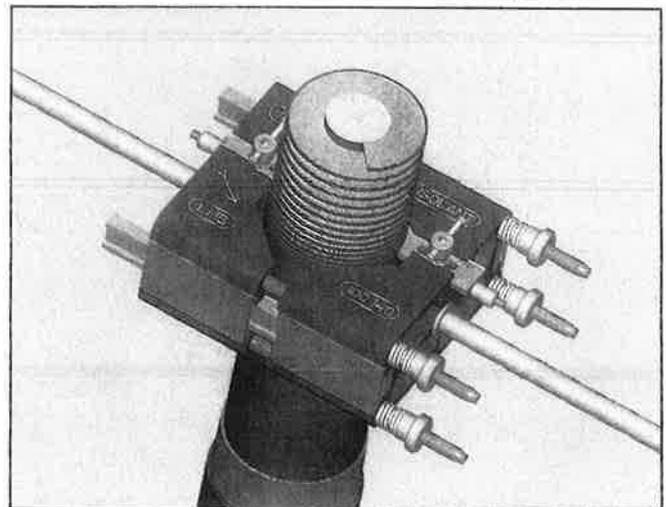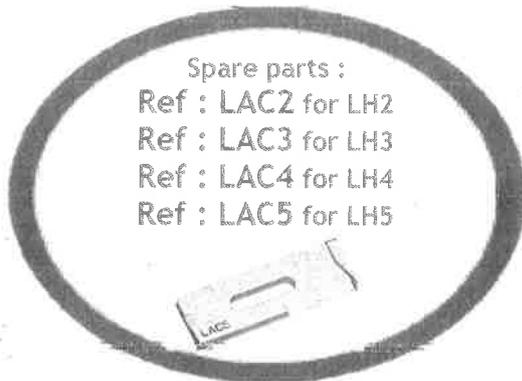

- ☞ The tools must be used when the cable is out of tension by skilled workers who are competent in cable preparation and know about electrical phenomenons.
- ☞ Wearing anti-cut gloves is obligatory.
- ☞ Clean the tools after each utilization.

ALROC S.A.S - ZI de la Fonderie - 72160 TUFFE - FRANCE - Phone : 33.(0)2.43.71.11.80 - Fax : 33.(0)2.43.71.16.51
Internet : www.alroc.fr - E.mail : commercial@alroc.fr - info@alroc.fr
S.A.S au capital de 800000€ - 341 050 987 RCS LE MANS - SIRET 341 050 987 00013 - APE 2453Z - TVA/FR 77 341 050 987